



*Your Final Destination.*

**CAPRON VITRIFIED PRIVATE LIMITED  
REG. OFFICE :- SURVEY NO.66/1,  
8-A NATIONAL HIGHWAY - At: RATAVIRDA,  
WANKANER 363621(GUJARAT), INDIA  
CIN. U26955GJ2016PTC092369**

## **TILES INSPECTION REPORT**

# Inspection Report

Report#: 1

Client Name	

Product Description	600X1200MM PGVT	
PO #		
Item #	60X120CM – PGVT	
Service Performed	FINAL INSPECTION REPORT	
Order Qty:		
Available Qty for inspection		
Batch Number		
Inspection Date		
Inspection Location	Morbi	

OVERALL INSPECTION CONCLUSION	To be confirmed by client
-------------------------------	---------------------------



Sections	Result	Remark No.
1. INDIAN ISO STANDARD	RANDOMLY CHECKED	1
2. Field test/special requirement	CONFIRMED	2
3. Data Measurement	CONFIRMED	3
4. Quantity	CONFIRMED	4
5. Style/ Color/Logo/Label	CONFIRMED	5
6. Marking/Packing/Packaging	CONFIRMED	5

## RESERVATION AND GENERAL REMARK

1. INDIAN ISO STANDARD - BOXES OPENED AS PER INDIAN ISO STANDARD STANDARD DEFECTS UNDER INDIAN ISO STANDARD PARAMETERS.
2. ONSITE TEST DONE PASSED.
3. ALL MEASURMENT TEST DONE PASSED.
4. 600X1200MM PRODUCTION PACEKD IN CARTOON PALLET PACKING YET TO BE DONE.
5. IN EACH AND EVERY BOX THERE IS MARKING WITH STICKERS & LABELING
6. PLEASE FIND THE ORDER DETAILS AS PER BELOW.

SR.NO	DESIGN NAME	SIZE	BATCH & SHADE NO	QUANTITY
1	REAL STATUARIO	600X1200MM	01106	1830
<b>GRAND TOTAL</b>				<b>1830 BOXES</b>

INDIAN ISO STANDARD RESULT -		PASS
SELECTED 30 BOXES	60 PIECES	30 BOXES
AQL LEVEL II	ALLOWED	FINDING
MAJOR – 2.5	3 PIECES	0
MINOR – 4.0	5 PIECES	04
	8 PIECES	4 PIECES

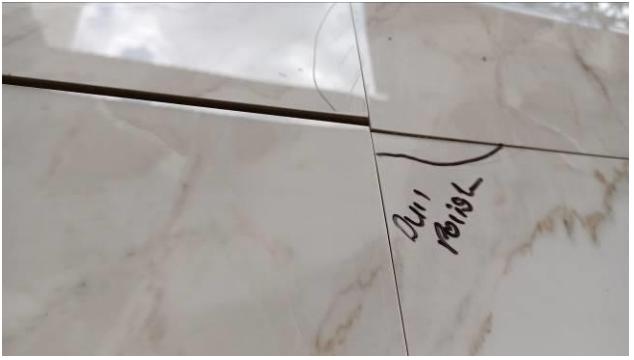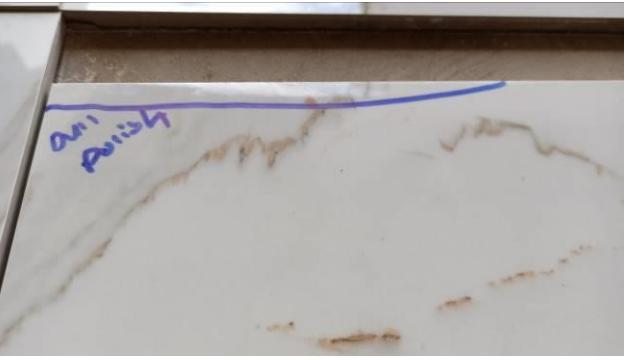1. INDIAN ISO STANDARD RESULT – PICTURES		Result: CONFIRMED
	MINOR – PINHOLE	
	MINOR – PINHOLE	
	MINOR – CHIPPING	MINOR – PINHOLE

2. Field test/special requirement	Result: CONFIRMED
-----------------------------------	-------------------

Description	Comments from	Result
<p><b>On-site Test:</b> Surface flatness</p> <p><b>Comments:</b> <math>\pm 0.1\%</math> is accepted, but different flatness in same piece like wave rejected.</p> <p><b>Sampling Level:</b> 5 pcs per item</p>		PASS



#### UNDER PARAMETER

SIDE = - 0.30MM

DIAGONAL = - 0.40MM

**On-site Test: SIZE & DIAGONAL TEST**  
**Comments: +/-0.1%**  
**Sampling Level: S-2 (04pcs)**

**ACTUAL READING AVG.**  
**SIZE VARIATION – 0.2MM**  
**DIAGONAL VARIATION – 0.5MM**

**PASS**



**On-site Test: Thickness measurement:**

**Comments:** Should be within +/- 0.50MM of specified thickness. Ensure the thickness of same piece is even, when we put tiles together, they are smooth on floor, no any wave.

**VARIATION UNDER 0.50MM**

**PASS**

**Sampling Level:** 2 PIECE PER ITEM



**On-site Test:** Breaking strength check

**Comments:** For thickness  $\geq 7.5$  mm: should be + than 380kg/cm<sup>2</sup>.

**Sampling Level:** 1 PIECES CHECKED

**M.O.R RESULT = ALL  
READING IN KG/CM2  
REQUIRED 380+ KG/CM2  
TILE- = 485.70KG/CM2**

**PASS**



**On-site Test: Color Shading check:**

**Comments:** Lay down the tiles on the floor and check that all the tiles are of the same shade. NO shading between tiles is allowed and no shading within the tile is allowed.

No white patches allowed.

This needs to be done for each of the shade referenced in the order.

Need very close to the golden sample or confirmed copy. We don't accept any shadow line. Color difference or designs missed in same piece are rejected.


**Sampling Level: 12 TO 16 pcs**

NO SHADE VARITATION FOUND

PASS



**DESIGN – REAL STATUARIO**



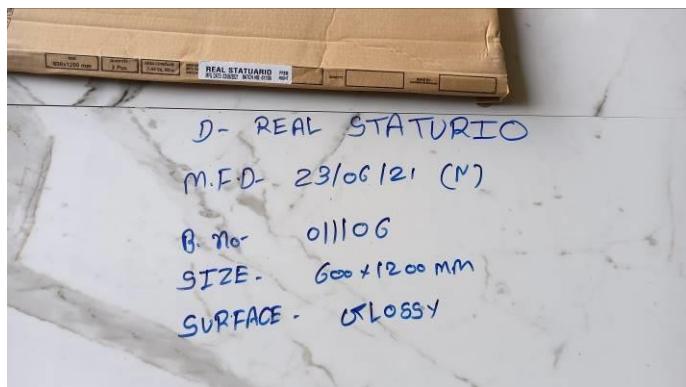

<b>On-site Test:</b> Fumigation stamp on pallet and fumigation certificate check <b>Comments:</b> Ensure that there is a fumigation stamp on every pallet. The factory should also be able to provide a fumigation certificate (Please take a picture) <b>Sampling Level:</b> all pallets	<b>PALLET PACKING YET NOT START</b>	Pending
---	-------------------------------------	---------

<b>On-site Test:</b> Packing list consistency check: <b>Comments:</b> <ul style="list-style-type: none"><li>- Total quantity</li><li>- Quantity per reference</li><li>- Number of pieces per cartons</li><li>- Number of cartons per pallets</li></ul> <b>Sampling Level:</b> S-1	<b>TOTAL 1830 BOXES READY PACEKD IN CARTOON</b> <b>2 PIECES PER CARTOON</b> <b>TOTAL 1 DESIGN.</b>	confirmed
<b>On-site Test:</b> Staining test <b>Comments:</b> After removing the Wax-> 1/ with marker 2/ This must be performed by Thinner or Ink water, choose one of five pieces to do it, painting the whole surface, all ink removed are accepted. If some pieces are found ink can't be removed, check more pieces to ensure it. <b>Sampling Level:</b> 2 PIECES		PASS

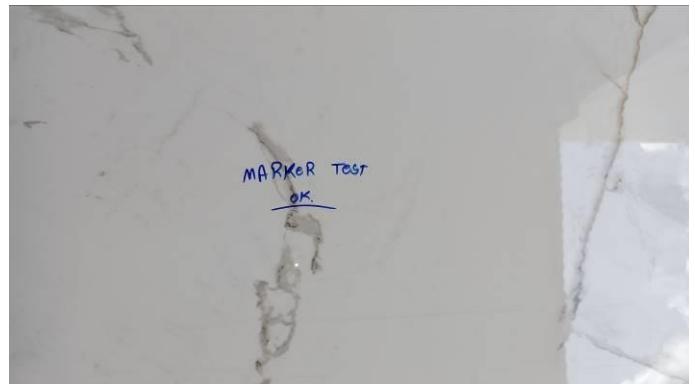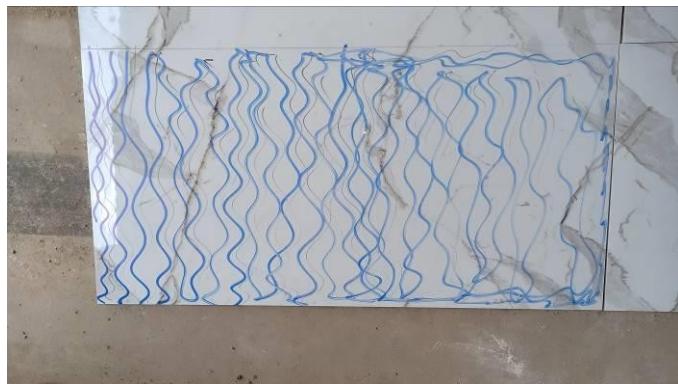

**On-site Test: Carton weight check**

**Comments:**

**Sampling Level: 1 CARTON**

**UPTO  
CLIENT**



**BOX WEIGHT**



**BOX WEIGHT – CLOSE VIEW**

**On-site Test: Glossy check****Comments:** check 9 points on tile must be above 90>**Sampling Level:** 2 pieces**UPTO  
CLIENT**

## 4. Quantity Conformity

Result: Confirmed

Style/item/ Reference Number	PO number	Order Qty	Available Qty			Not finished QTY (pcs)	Sample size from	
			Packed (Pcs)	Packed (CTN)	Unpacked (Pcs)		Packed Lot	Unpacked Lot
PGVT 60X120CM	1	1830 Boxes	3660	1830 Boxes				
<b>Comment:</b>	<b>2 containers</b>							
<b>Note:</b>	MATERIAL PACKED IN CARTOON YET NOT PALLISED.							

Photos: **STICKERS & PACKING & BARCODE**


Photos: STICKERS & PACKING & BARCODE



5. Style/ color Conformity:	Result:
-----------------------------	---------

INDIAN ISO STANDARD:	Result	Comment
	OK/ NOT OK / N/A	
<b>Compared with approval sample</b>	N/A	
<b>- Style:</b>	N/A	PGVT – 600X1200MM
<b>- Color:</b>	N/A	
<b>- Logo:</b>	OK	MADE IN INDIA LOGO FOUND
<b>-Marking/Label:</b>	OK	STICKER FOUND IN EVERY BOXES
<b>-Country Origin label:</b>	OK	
<b>- Others</b>	N/A	

**Photos:**

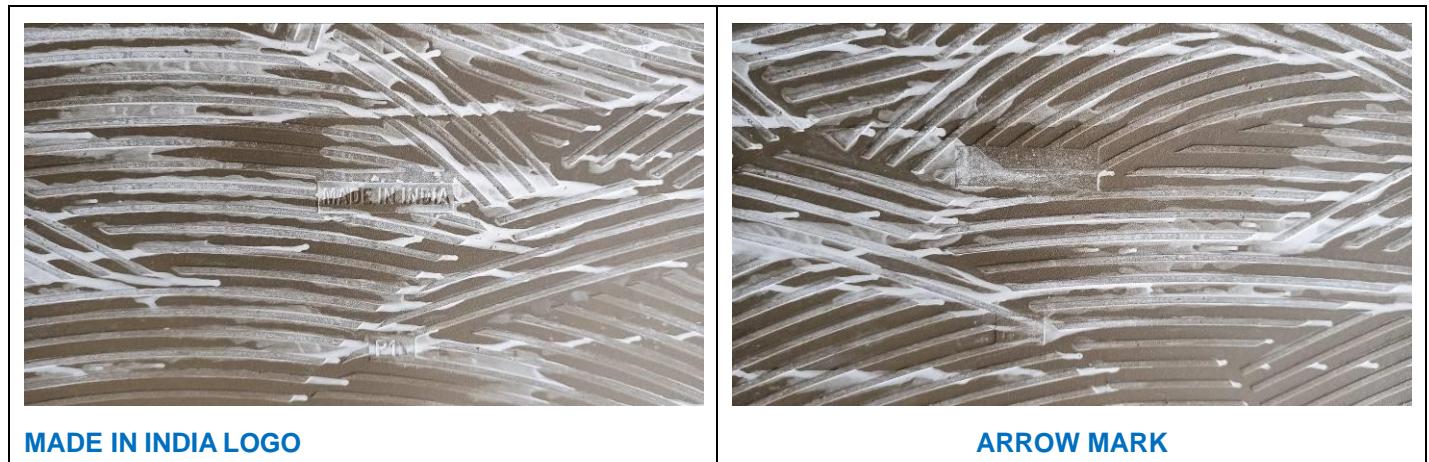

**- End of the Report -**